

Bulletin CQB 02-09

Subject: Wheel Speed Sensor Signal loss.

Vehicle Involved: 2001 Chevrolet Tracker

Condition: Some Chevrolet Trackers may set an Anti Lock Brake System Diagnostic Trouble Code C1232, left front wheel speed sensor open, or shorted. The left wheel speed sensor wiring may be wrapped around the Air Conditioning suction hose, causing tension within the white sensor connector. A loss in communication from the sensor to the ABS EBCM may occur setting the code C1232.

Repair Procedure: The white connector is located near the coolant recovery bottle, on the driver's side inner front fender. Note the position of the left front speed sensor wiring. The wiring should **not** be routed around the AC hose. It should be parallel to the inner fender along its lower edge, not contacting the AC hose.